


Notice for used POLY-DT

Combinated insulation and external sheath removal tool

Part 1 : External sheath

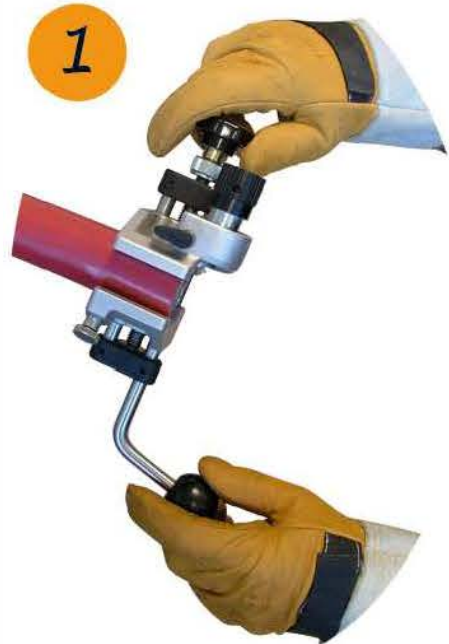

Put the tool on the cable without free but with possibility to turn



Lock the ajustement using the locking nut



Adjust the tip of the blade up to $\approx 0.5\text{mm}$ from the screen



Put the black lever at the position "ON" corresponding to hélicoïdal cutting



Strip the sheath, turning the tool clockwise with the handle



Arriving the stripping limit (note the width of the tool is 50mm), stop the tool, and turn back half a turn



Put the blade lever in position "OFF" corresponding to the straight cut



Finish with the straight cut turning 2 turns



Remove the sheath and the tool

